

# Challenges on ENEPIG Finished PCBs: Gold Ball Bonding and Pad Metal Lift

Young K. Song and Vanja Bukva  
Teledyne DALSA Inc.  
Waterloo, ON, Canada

## Abstract

As a surface finish for PCBs, Electroless Nickel/Electroless Palladium/Immersion Gold (ENEPIG) was selected over Electroless Nickel/Immersion Gold (ENIG) for CMOS image sensor applications with both surface mount technology (SMT) and gold ball bonding processes in mind based on the research available on-line. Challenges in the wire bonding process on ENEPIG with regards to bondability and other plating related issues are summarized.

Gold ball bonding with 25um diameter wire was performed. Printed circuit boards (PCBs) were surface mounted prior to the wire bonding process with Pb-free solder paste with water soluble organic acid (OA) flux. The standard gold ball bonding process (ball / stitch bonds) was attempted during process development and pre-production stages, but this process was not stable enough for volume production due to variation in bondability within one batch and between PCB batches. This resulted in the standard gold ball bonding process being changed to stand-off-stitch bonding (SSB) or the ball-stitch-on-ball (BSOB) bonding process, in order to achieve gold ball bonding successfully on PCBs with an ENEPIG finish for volume production.

Another area of concern was pad metal lifting (PML) experienced on some PCBs, and PCB batches, where the palladium (Pd) layer was completely separated from nickel (Ni) either during wire bonding or during sample destructive wire pull tests, indicating potential failures in the remainder of the batch. Evaluation of failed PCBs was performed using cross-section analysis, X-Ray Fluorescence (XRF), and Scanning Electron Microscopy (SEM)/Energy Dispersive x-ray Spectroscopy (EDS), which identified process issues, such as inclusions, or hyper corrosion which caused either localized or complete separation of the Pd from Ni layer. Through extensive investigation, using 8D and Kepner-Tregoe problem solving methods, solutions to the problem were discovered in the majority of cases, even though the exact root cause remained unclear due to multiple PCB manufacturing variables being changed at the same time.

## Introduction

There are various types of surface finishes of PCBs available depending on the requirements of applications. One of the most popular surface finishes used is Electroless Nickel/Immersion Gold (ENIG) with advantages such as good wettability [1,2], relatively low cost [1,2], ability to meet small form factor with finer lines, smaller pitch, and high routing density [1,3]. However, ENIG historically exhibited black pad issues [1,2,4,5] and is incompatible with the thermosonic gold ball bonding process [1,2,6]. Electrolytic nickel and electrolytic gold provides excellent wire bonding performance, but trade-offs include high process cost, poorer solder joint reliability due to the high gold content, and worse co-planarity, which limits feature densities [6].

The Electroless Ni/Electroless Pd/Immersion Gold (ENEPIG) emerged in the late 1990's [6]. The addition of a palladium layer between nickel and gold was expected to solve the black pad issue due to hyper corrosion of Ni during gold plating because Pd serves as a barrier preventing gold bath penetration into Ni and diffusion of Ni to the surface of gold [1,2,6,7]. Gold wire bondability has been reported to be compatible with an ENEPIG plated surface finish from multiple authors [1,2,6] and suggestions with regards to Pd and Au plating thickness [3] and purity of Pd for gold wire bonding application can be found [8].

Based on our analysis of the research available on-line, ENEPIG was selected as a surface finish for PCBs over Electroless Nickel/Immersion Gold (ENIG) for CMOS image sensor applications with both surface mount technology (SMT) and gold ball bonding processes. However, the plating specifications suggested in the literature [3, 8] could not be sourced. Gold ball bonding was preferred over aluminum wedge bonding for our applications, mainly due to faster bonding speed which would significantly affect production throughput. Challenges in the gold ball bonding process on ENEPIG finished surface mounted PCBs are described below. In addition to wire bonding challenges, pad metal lift failures between Pd and Ni layers

during wire bonding and the destructive pull test, and attempts to determine the root causes of pad metal lifts are presented. To identify the root cause of pad metal lift, 8D and Kepner-Tregoe problem solving techniques were used.

## Experimental

### Printed circuit board

Printed circuit boards (PCBs) discussed in this paper are for multiple image sensor product applications with different PCB layouts. There were 5 different bare board samples (a batch or batches) as shown in Table 1. All the PCBs utilized for gold ball bonding process were surface mounted with water soluble organic acid (OA) flux prior to wire bonding process at the same contract manufacturer. PCB sample E which was surface mounted with no-clean flux and was aluminum wire bonded, will be reviewed for PML results only. The plating specifications and flux types used for PCB assembly for different bare board samples are summarized in Table 1. The PCB material for all the products is FR4 with multiple layers with thickness of about 1.8mm except for that from sample E which is about 1.3mm.


**Table 1-SMT Process Used and Plating Specifications**

Bare board sample	Flux type	Bonding Process	Plating thickness specifications (um)		
			Ni (P)	Pd (P)	Au
A	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
B	OA	gold ball bonding	3.0-8.0	0.3-1.0	0.05-0.18
C	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
D	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
E	No clean	aluminum wedge bonding	3.0-6.0	0.05-0.30	> 0.03

### Wire bonding

All the PCB samples in Table 1 were sourced for production use. Some PCBs from samples A, B, and C were selected for gold wire bonding evaluation (wire pull strength evaluation) and the results are discussed in the following gold ball bonding section. From 5 samples, PMLs were observed from samples A, D, and E during production builds. Those samples are discussed in the PML section.

The evolution of gold ball bonding process on ENEPIG surface finished PCBs is to be examined. Figure 1 shows a partial view of the PCB layout used for one of the image sensor products showing surface mounted components and wire bonding pads with wire bonding rings indicated by arrows as well as individually defined wire bonding pads. The area shown in a rectangular shape in red is representative of 4 similar areas on the subject board and was used for standard gold bonding and will be the subject of the subsequent evaluation.

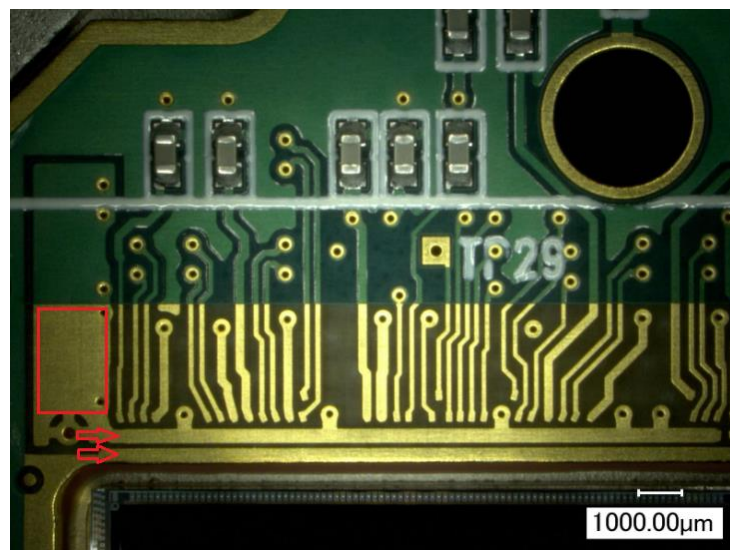

**Figure 1- Partial View of Sample PCB**

Gold wire bonding evaluations were conducted on both bare and populated PCBs for experiments, but the wire bonding process during image sensor assembly was applied to populated PCBs. Each populated board was plasma cleaned two times during image sensor assembly process, once prior to die attach and another prior to wire bonding.

Wire bonding was conducted on a gold ball bonder at a bonding temperature of about 155-160°C on the PCB surface using 25um 4N gold wire. The bonding tool used for the wire bonding process was for off-the-shelf 80um pitch applications with capillary tip dimensions of about 100um. Wire pull tests were conducted to measure wire bond strength.

## Results and Discussions

### Gold Ball Bonding

The standard gold ball bonding process makes a bonded wire that consists of a ball bond and a stitch bond as shown in Figure 2 and Figure 3, respectively. The ball bond, also called the first bond, is commonly made on die bonding pads, and the stitch bond, also called the second bond, is made on substrate bonding pads. In Figure 2 and Figure 3, both ball bonds and stitch bonds are made on a PCB substrate and the wire bonding evaluation is focused on stitch bond (second bond) capability on a PCB. In general, bonding windows for the stitch bonds (second bonds) are smaller than those for the ball bonds (first bonds) which means that stitch bonds are more susceptible to non-sticking due to plating quality or surface contamination compared to ball bonds.

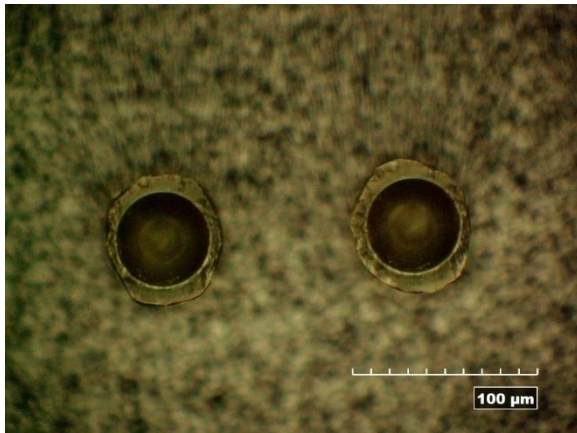


Figure 2 - Ball Bonds (1<sup>st</sup> bonds)

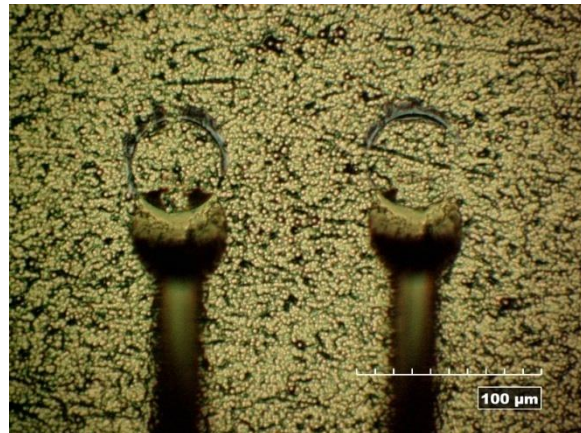


Figure 3 - Stitch Bonds (2<sup>nd</sup> bonds)

The standard gold wire bonding process as shown in Figure 2 and Figure 3 has been planned as the wire bonding process at the beginning of process development based on the literature reviews [1,2,6]. However, it has been noticed that wire pull strength of populated boards varies significantly within and between the batches. Figure 4 and Figure 5 show the box plots of pull strength of populated boards compared to that of bare board samples A and B. The box plots show the median in the central rectangle and the central rectangle shows interquartile range. In addition, bare boards baked at 245°C/5min are included in Figure 4 to simulate the effect of temperature during the SMT process on wire pull strength. This was based on the assumption that if a 245°C/5min bake only affects the wire bondability, Ni (or other metallic elements such as Cu) diffusion to a wire bonding surface would be a potential mechanism for wire bonding issues for populated boards.

Wire bonds were made in PCB areas as shown in Figure 1 in red for wire pull strength comparison for the standard gold bonding process. For comparison between bare and populated boards, boards from the same bare board batch were used to eliminate the effect of batch to batch variation. As shown in Figure 4 and Figure 5, it is obvious that wire pull strength of populated boards is lower than that of bare boards. However, the bare boards baked at 245°C/5min., in order to simulate thermal effect during SMT process, do not show any degradation in wire pull strength compared to bare boards, indicating that Ni migration is not likely to occur to wire bonding surfaces during the SMT process.

Note that all of the samples evaluated have been subjected to die attach cure at 150°C/40min. Even though boards were washed with extra cycles using deionized (DI) water to remove OA flux residues at the subcontractor and plasma cleaned during image sensor assembly in-house, there seemed to be some level of contamination still remaining on wire bonding pads

from the SMT process affecting wire bondability. However, contamination was not noticeable on an optical microscope from the populated boards used in Figure 4 and Figure 5.

In addition to potential contamination during the SMT process, another potential issue observed was variation in flatness and/or roughness of the bonding surface, which was indicated by non-uniform tool marks on the PCB pad surface. There was one outlier with low pull strength value obtained from bare board 3 and there were three non-sticking bonds during wire bonding from populated boards 3 in Figure 4. Low pull strength from bare board 3 and non-sticking bonds from populated boards might be related to insufficient squash of bonding wire due to the non-flat bonding surface. Otherwise, ENEPIG plated boards seem to show good wire bondability on the bare board level.

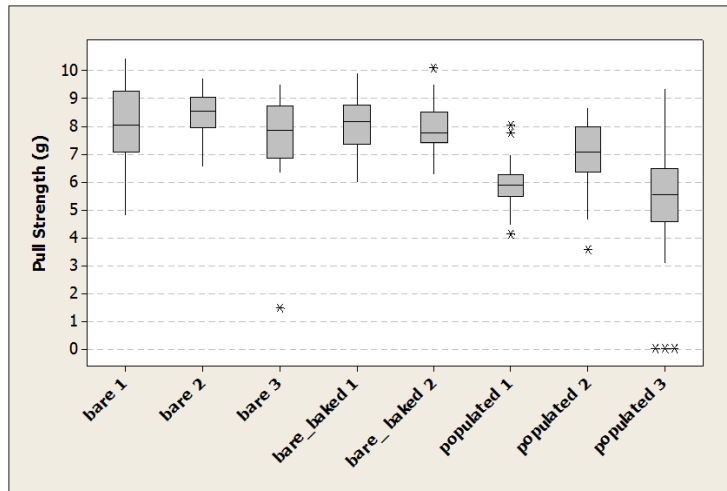


Figure 4 - Wire Pull Strength Comparison Between Bare and Populated Boards from Sample A


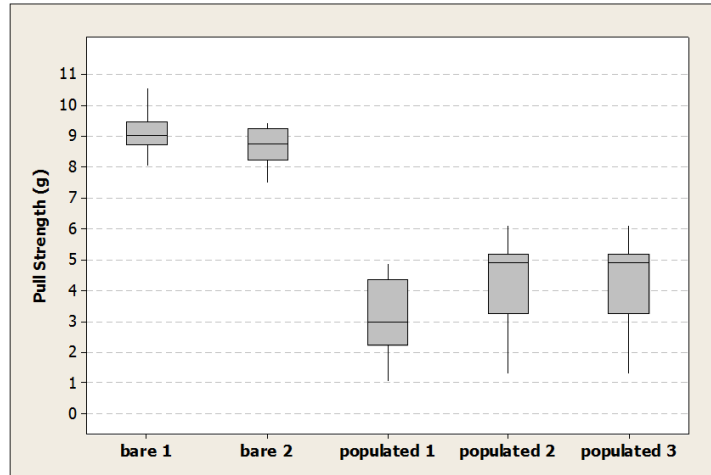



Figure 5 –Wire Pull Strength Comparison Between Bare and Populated Boards from Sample B

Figure 6 shows tool mark variation observed during evaluation, likely related to surface flatness or roughness. A tool mark shape (Figure 6, right-bottom) exhibits the preferred full circle, but most tool mark shapes are broken circles. One low pull strength value from bare board 3 in Figure 4 is from the bond with the tool mark at the left-top in Figure 6 (half or less than half circle opposite to squashed wire). Very similar tool marks are also observed from the non-stuck wire bonds on populated boards 3 in Figure 4.

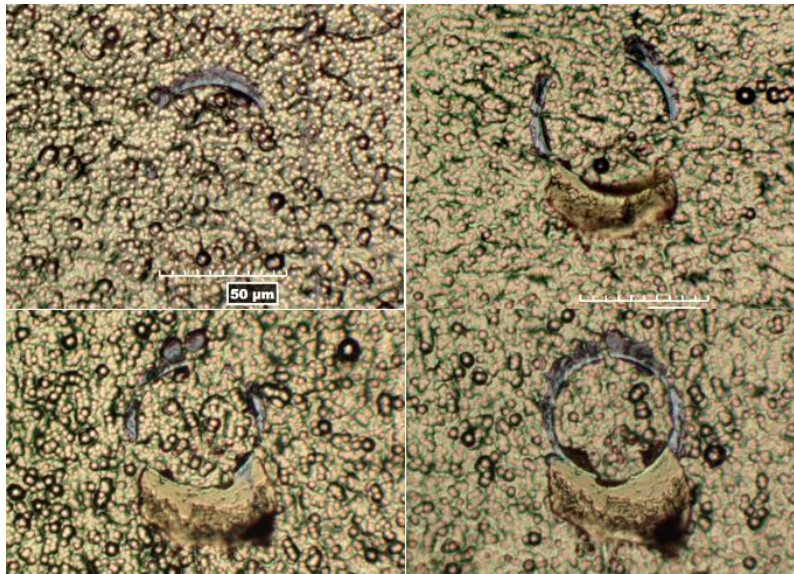

**Figure 6 - Variation in Tool Marks**

Figure 7 shows the pull strength variation of mixed batches of populated boards from sample C as an example of potential wire pull variation of populated boards using the standard gold ball bonding process. However, it could not be clearly determined whether the plating process or the SMT process was responsible for the variation in pull strength for each board used for Figure 7.

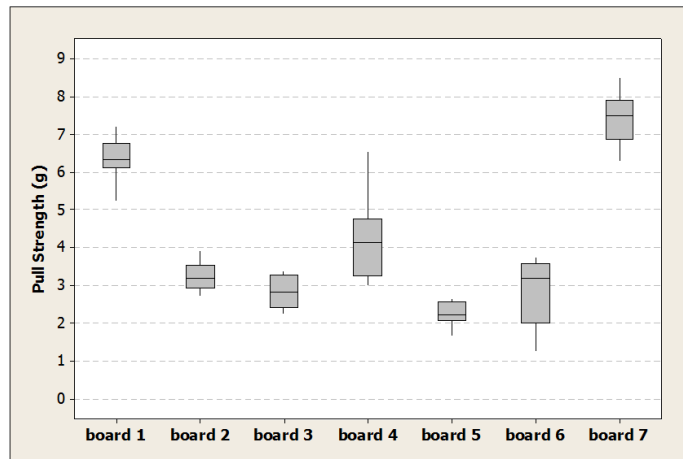

**Figure 7 - Wire Pull Strength from Mixed Batches of Populated Boards from Sample C**


Due to the variation and degradation of wire bondability of the standard gold bonding process on populated boards for our image sensor applications, the wire bonding process was changed, first from the originally planned standard ball bonding process, then to security bump process, and ultimately to the stand-off-stitch bond (SSB) process (also called the ball-stitch-on-ball process). The security bump process and the SSB process are also types of gold ball bonding process and the difference between standard bonding, security bump, and SSB processes is described in detail in the following paragraphs.

Figure 8 and Figure 9 show the shapes of ball bonds on the die and stitch bonds on the PCB bonding pads for the security bump process. Compare stitch bond shapes between the standard gold bonding process in Figure 3 and the security bump process in Figure 9. The security bump process enhances wire pull strength on the stitch bond since additional bump is applied on the stitch bond as shown in Figure 9, but the process still requires continuous bonding capability without non-sticking or losing the tail during the stitch bond process.


However, when the wire bondability of the populated PCBs is not adequate, the implementation of the security bump process does not guarantee a satisfactory result in preventing non-sticking or losing tails. A stable bonding process without wire

bonding failure is critical for applications with a large number of wire bond counts in a device. Figure 10 and Figure 11 show the shapes of ball bonds on PCBs and stitch bonds on die bonding pads for the SSB process.


For standard bonding and security bonding processes, a ball bond is made on the die bonding pad (Figure 2 and Figure 8) and a stitch bond is made on the substrate (PCB) bonding pad (Figure 3 and Figure 9). However, for SSB process, a bump is first applied on the die bonding pad. Next, a ball bond is made on the substrate (PCB) bonding pad (Figure 10) and then a stitch bond is made directly on the bump on the die bonding pad (Figure 11). Therefore, ball bonding is applied on both die and PCB bonding pads, unlike the standard gold bonding and security bump processes. As mentioned earlier, the ball bonding process has a much larger bonding window tolerance variation in plating quality and the level of contamination than the stitch bonding process.

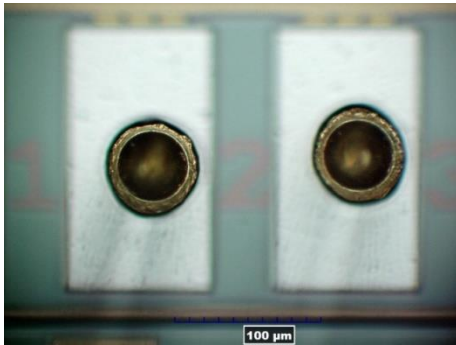


**Figure 8 - Ball Bonds for Security Bump Process**

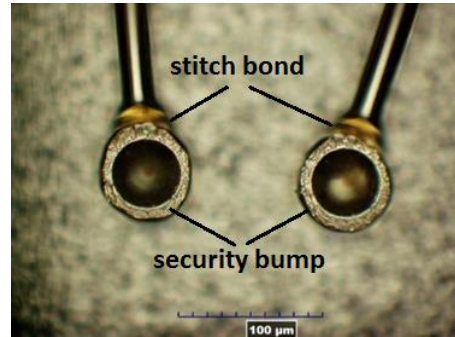

**Figure 9 - Stitch Bonds with Security Bumps for Security Bump Process**

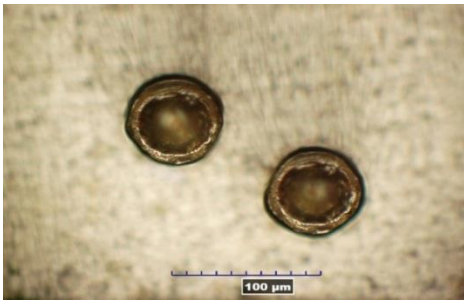


**Figure 10 - Ball Bonds for Stand-off Stitch (SSB) Process**

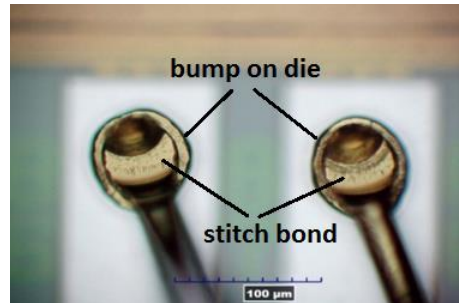

**Figure 11 - Stitch Bonds Made on Bumps for SSB Process**

Figure 12 shows the pull test result from the SSB process on populated boards from samples A and B. There were between 145-155 bonds pull tested on each board. There is no failure related to PCB plating quality such as bond lift failure on the PCB bonding pads. Several wire bonds exhibited a stitch break failure mode (on die), but most wire bonds showed neck break failure which was the preferable failure mode. The variation in pull strength in Figure 12 is due to the fact that wire bonds tested were from a mixture of short and long wire bonds with loops at different heights rather than due to variation in bondability on the PCB. Machine stoppage or non-sticking had rarely been reported since the SSB process was introduced, however, a new issue, pad metal lift (PML), was observed in ENEPIG plating in some batches of PCBs not related to the SSB process. Details about this issue are discussed in the following section.

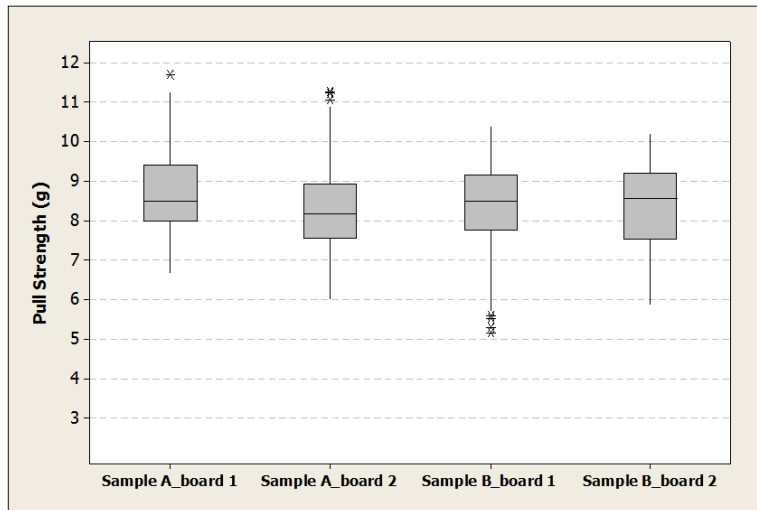


**Figure 12 - Wire Pull Strength from Populated Boards with SSB Process**


**Pad metal lift**

Another area of concern was pad metal lift (PML) experienced on some PCBs and PCB batches where the palladium (Pd) layer was completely separated from the nickel (Ni) either during wire bonding or during the sample destructive wire pull tests. PMLs have been observed from both bare and populated boards, therefore, they do not seem to be related to the SMT process. Figure 13 shows the bottom of the lifted bond as an example.


Separation of the Pd layer from the Ni layer was confirmed by EDS analyses conducted on the area on the bonding pad with the lifted bond and the bottom of lifted bonds as shown in Figure 14 and Figure 15, respectively. Ni was the major element in the area on the bonding pad with a lifted bond in Figure 14 and Pd was the major element detected at the bottom of the lifted bond in Figure 15.

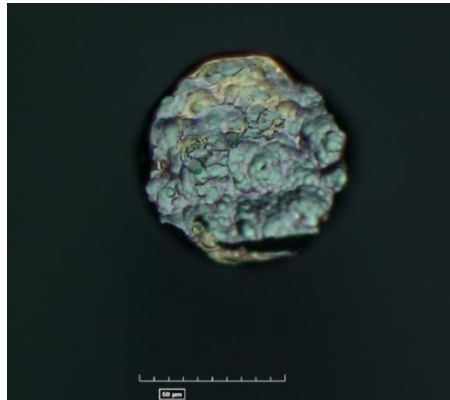

**Figure 13 - Bottom of a Lifted Bond**

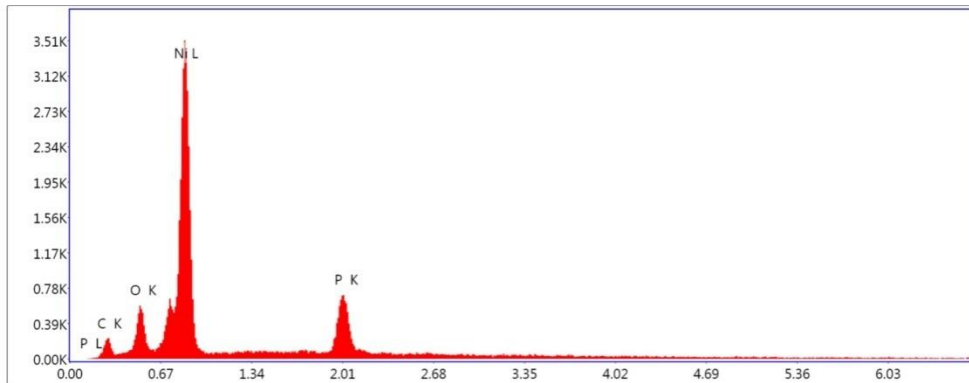

**Figure 14 - EDS Analysis Spectrum Obtained from The Area on Bonding Pad with Lifted Bond**

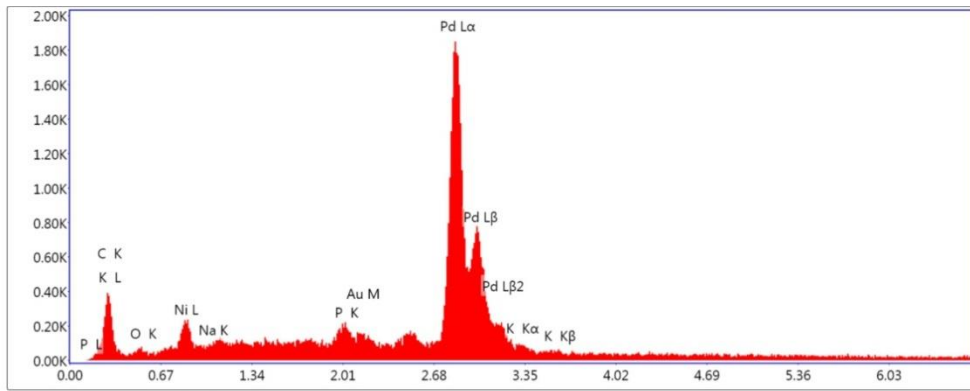


**Figure 15 - EDS Analysis Spectrum Obtained from The Bottom of Lifted Bond**


A PML was observed on 3 different PCB samples. The following section presents the various degrees of the PML experienced on the PCB samples.

**Sample A**

One of the incidents where PML was observed on the sample A of the PCBs is shown as per Figure 16 and Figure 17.

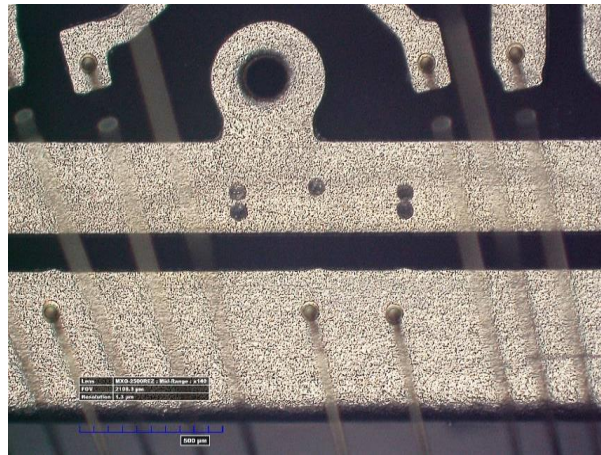

**Figure 16 - Five Black Circles Represent PML Including Attempts to Repair**

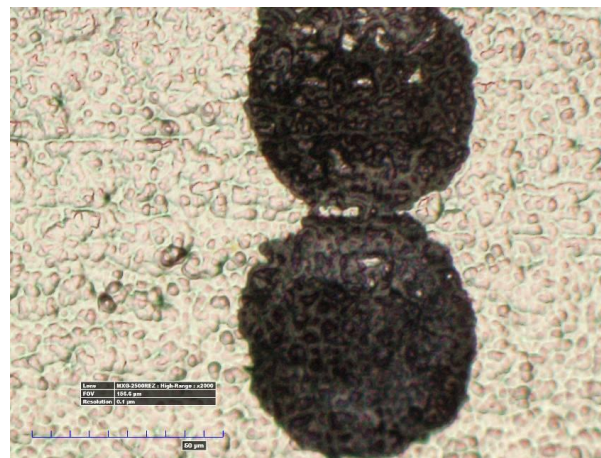

**Figure 17 – Zoom in on PML Area**


The circular shape of the pad metal lifted area is the shape of the wire bond. Using an optical microscope, it is clear that the entire area with pad metal lift looked black in color, which was different from those identified from other samples presented in the following sections.



A supplier noticed a process issue during the production of this batch. The root cause proposed by the supplier was an overactive Ni bath, which can be caused by temperature or excessive copper loading, or a combination of both. In this case, it was determined that the copper loading had been excessive over the course of several consecutive loads. ENEPIG plating was found on the solder mask and some boards failed the tape test for poor Pd adhesion to Ni. However, the tape testing, which was performed per IPC-TM-650, was not effective in completely screening out the PCBs affected and wire bonding failures were observed as per Figure 16 and Figure 17.


### Sample D

Figure 18 shows an example of PML occurring in one of PCB batches from the sample D. PML was observed during wire bonding. The color of the area with the lifted bonds showed mostly a mixture of fresh Ni-like color and spots in black color as shown in Figure 18, but some showed just fresh Ni-like color in the entire area.

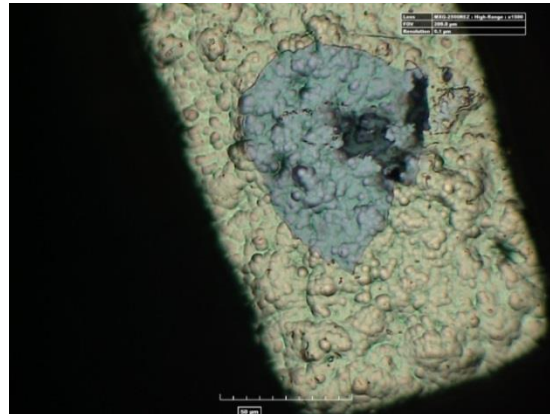


**Figure 18 - PML from Sample D**

Boards were sent for cross-section, XRF measurements and SEM analysis. Hyper-corrosion was observed through the analysis as shown in Figure 19. It was believed that hyper-corrosion was the cause of the PML, where Pd had separated from the Ni layer. Hyper-corrosion is a result of hyperactivity of the immersion gold bath causing severe corrosion of the nickel, which then creates the possibility of the Pd layer having poor adhesion. Note that the top thick layer in Figure 19 is an over-plated nickel layer, the purpose being for sample preparation.

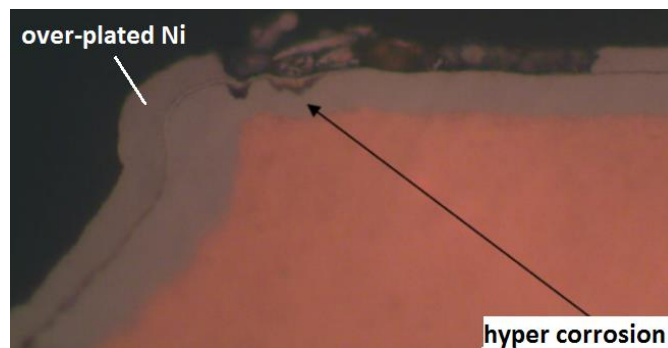


**Figure 19 –Image of Edge Hyper Corrosion at Lens 1000x (ignore top, over-plated layer for sample preparation)**

Figure 20 shows a cross-sectioned view of the edge of the bonding pad. The top thick layer is the over-plated Ni layer for the purpose of sample preparation. Hyper corrosion of Ni beneath Pd is visible in Figure 20. Figure 21 shows hyper corrosion of Ni in the wire bonding pad in the area with the lifted Pd layer.

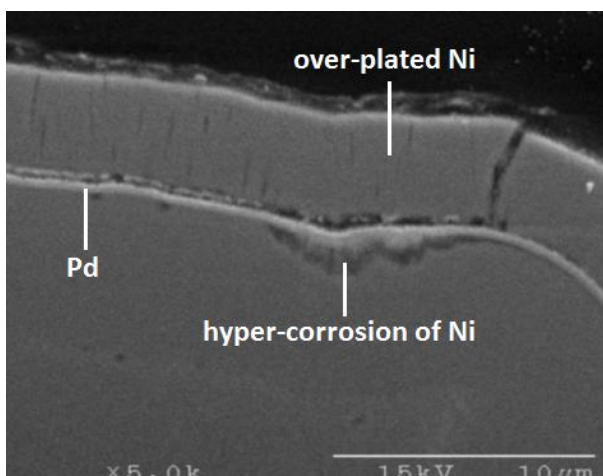

**Figure 20 – SEM Image of the Edge of the Pad Showing Hyper Corrosion of the Ni Beneath the Pd**

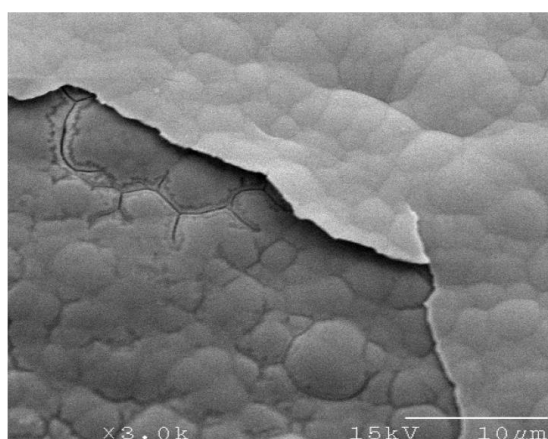

**Figure 21 – SEM Image of the Same Failed Site Showing Lifted Pd and Hyper Corrosion of the Ni**

Comparison between batches that have been successfully wire bonded and the batch which failed at wire bonding was made in respect to plating thickness. XRF measurements of the failed board demonstrated the thinnest Pd deposit combined with the thickest Au deposit, both within tolerance of the IPC-4556 specification for plating thickness. The combination of thin Pd and thick Au deposit appeared to compromise Pd bond strength possibly from the undercutting of the Ni/Pd interface due to localized heavy hyper corrosion. In technical discussions with multiple experts, it was suggested to reduce the Au thickness range from specified 0.05 – 0.15 um to the range of 0.03 – 0.06um, and increase Pd thickness range from the specified 0.10 – 0.20 um, to 0.15 – 0.30 um as shown in Table 2. Two trials were performed with the modified plating thickness specification, with two different suppliers and results were encouraging. No PML was observed during wire bonding and wire pull tests. The cross-section was performed on trial boards from both suppliers and hyper corrosion was not observed.

**Table 2 – Plating Thickness for Reduced Hyper Corrosion**

Thickness	Original specification	Modified specification to minimize hyper-corrosion
Au	0.05 – 0.15 um (2 – 6 uin)	0.03 – 0.06 um (1.2 – 2.4 uin)
Pd	0.10 – 0.20 um (4 – 8 uin)	0.15 – 0.30 um (6 – 12 uin)
Ni	3 - 5um (118 – 200 uin)	3 – 6 um (118 – 236 uin)*

\*Increased Ni thickness to be consistent with IPC-4556, not relevant to hyper corrosion investigation.


A second PML incident involving another PCB batch occurred during wire bond and wire pull tests. Boards were sent for cross-section, XRF measurements and SEM analysis. It was determined that the cause of Pd and Ni separation in this case

was not due to hyper corrosion. Cross-sectioned boards exhibited the separation between the Pd and the Ni without hyper corrosion of nickel. Figure 22 shows a demarcation (separation) line which should not normally be visible.




**Figure 22 - Edge of the Pad Showing Demarcation Line at 1000x Lens.**

SEM analysis showed some variation in the grain size of the Ni deposit from failed boards in Figure 23. However, variation in grain size of Ni is not expected to be responsible for PML. Figure 24 shows a small area with missing Pd layer from the surface and the grain boundary attack on the underlying nickel indicating that the Pd layer was missing when the sample was plated in the Au bath.

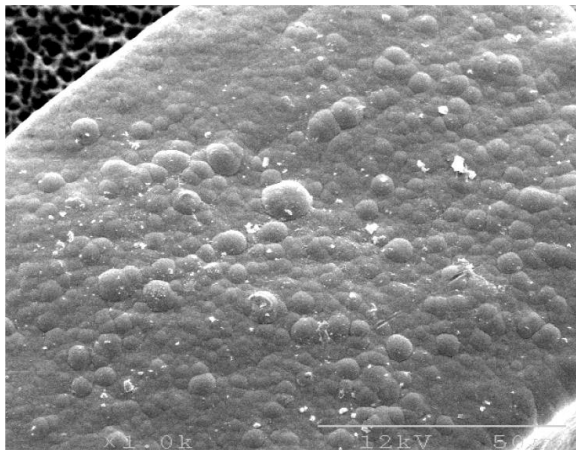


**Figure 23 – SEM Image of Wire Bond Pad Showing Variation in the Grain Size of Ni Deposit at 1000x**

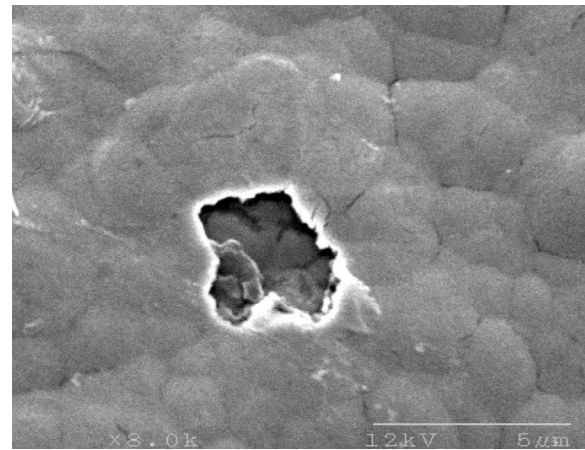


**Figure 24 – SEM Image Showing Missing Pd at 8000X**

The third incident of PML was observed from a new batch of PCBs. Figure 25 shows an optical microscope image of PML observed on this batch.

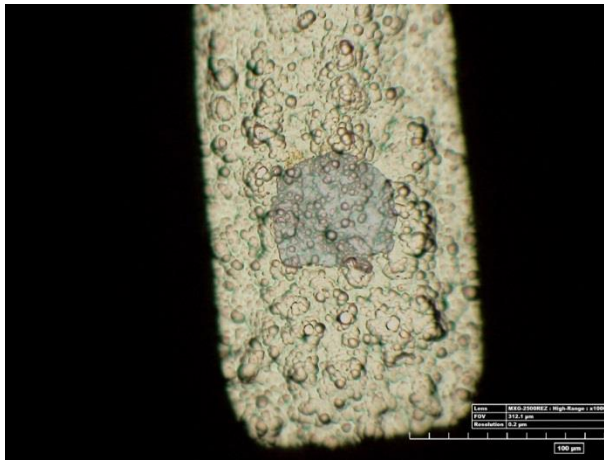


**Figure 25 – Optical Microscope Image of PML**


Plating thickness measurements using XRF on a same board of this batch showed inconsistency of Au and Pd thickness. The board showed extensive hyper corrosion, causing Pd and Ni separation as shown in the cross-section of the board in Figure 26 and also showed the evidence of flaked or lifted off Pd layer at the edge of bonding pad in Figure 27. Trans-granular cracking in the Pd layer was also observed as shown in Figure 28 even though it is not known if trans-granular cracking is related to PML.

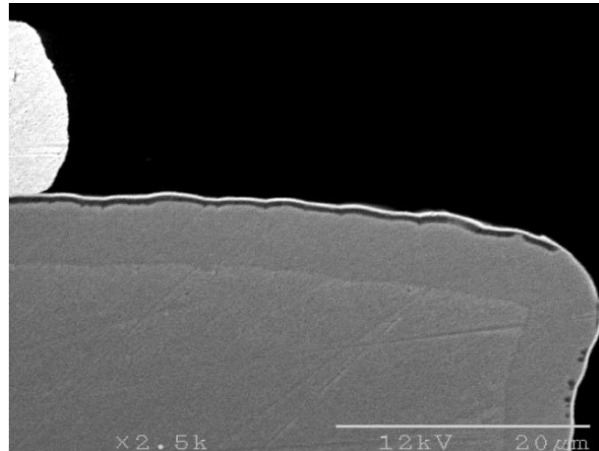

**Figure 26 – SEM Image at 2500X Showing Extensive Hyper Corrosion**

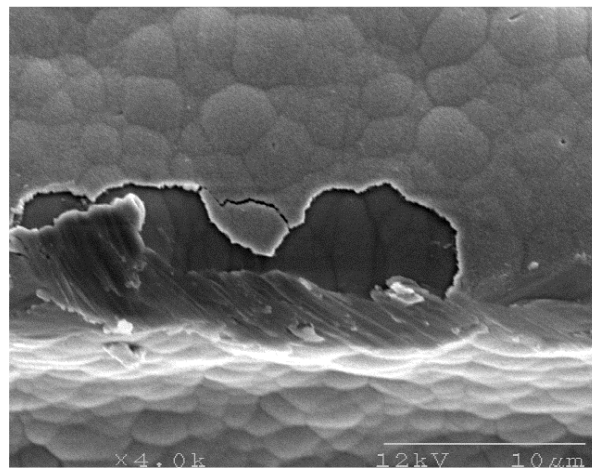

**Figure 27 –SEM Image at 4000X Showing the Lifting Pd Layer**

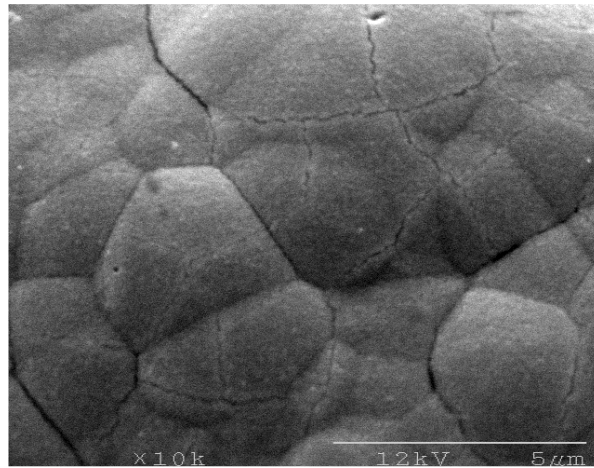

**Figure 28 – SEM Image of the Pd Surface Showing the Trans-granular Cracking of the Pd**

The root cause investigation of PMLs possibly with 3 different root causes from 3 different batches of sample D involved review of multiple variables at the PCB manufacturer as follows:


- Si content in the plant DI water was found to be 4 PPM. The Si levels dropped to 0.004 PPM after DI columns were added to strip Si from the water supply.
- The rinse time after Ni plating (before Pd plating) was reduced from 60s to 30s to minimize possibility of Ni oxidation.
- The practice was improved by eliminating panels being placed on hold prior to final Au finish in order to reduce the amount of oxidation on panels.
- A custom heating coil and a cooling coil were added in Pd tank.
- Improvement of Ni bath Metal Turn Overs (MTOs) to 1 MTO.

The final conclusion was that the root cause was most likely high MTOs and overall life of the Ni bath, with all other causes as possible contributing factors.


### **Sample E**

PCBs from sample E were wire bonded using aluminum wedge bonding unlike PCBs from samples A and D which were wire bonded using gold wire bonding. Figure 29 shows an example of PML from sample E observed during the aluminum wedge bonding process.

Cross-sectioning of PCBs for the analysis of PML from sample D showed that the separation between Pd and Ni layer was along a relatively large interface area. However, cross-sectioning of the PCB from sample E showed that the separation between Ni and Pd layer was very localized as shown in Figure 30. There is no evidence of any hyper corrosion present in Ni in this instance. Particularly noted is the “step” or 90 degree portion of the Pd layer where the lifting starts. Pd would not be considered a ductile material and this would appear to indicate that some disturbance caused the change in plating direction and may potentially be responsible for the lack of adhesion.

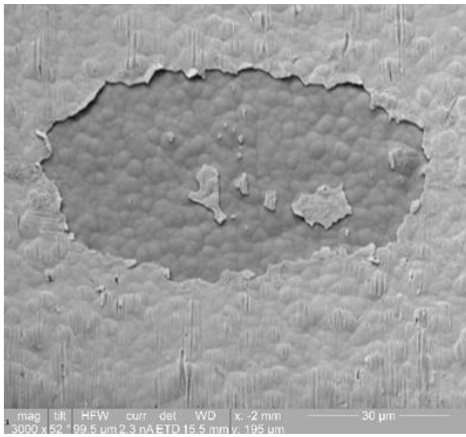


**Figure 29 - SEM Image of the Lifted Bond at 3000x**

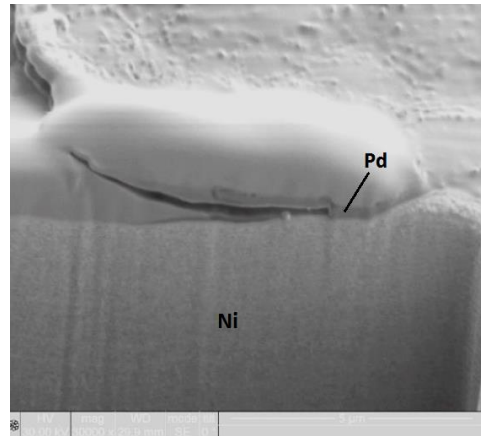

**Figure 30 - FIB Image of the Lifting Pd from Ni at 30,000X**

Figure 31 shows a cross-sectioned view of another PCB from sample E, in which inclusion in the Ni layer was observed and also hyper corrosion of Ni was present. The size of interface defects, an inclusion and Ni hyper corrosion, was much smaller (about 5 um wide) than those which were observed on sample D PCBs (usually about 50 um).

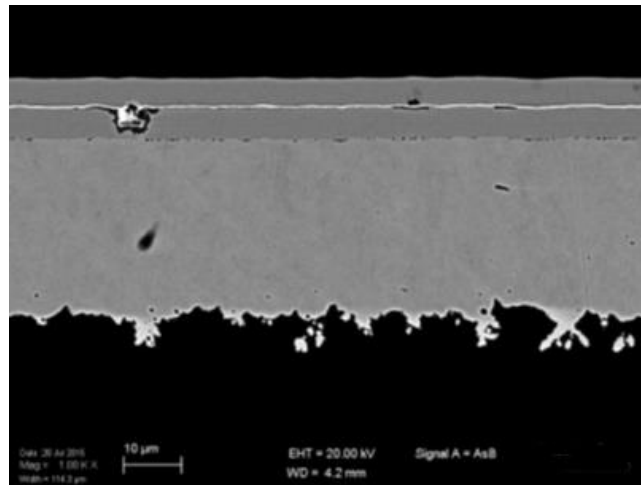

**Figure 31 -Inclusion in Ni layer and Ni Hyper Corrosion**

Even though a tape test as per IPC-TM-650 had been implemented on each PCB at the supplier, as well as at receiving, PML still occurred during wire bonding. Attempts to repair wire bonds in the adjacent area where PML occurred were successful without PML during the wire bonding and pull test. Boards were sent for temperature cycling testing (TCT). A sample of 13 boards with repaired bonds was temperature cycling tested with the following condition: temperature range of -15°C to 60°C with ramp up and down at 2.5°C per min. for 100 cycles. Dwell time was 55min. at -15°C and 60°C. There were no wire bond failures observed.

The root cause investigation of PML was halted before the root cause had been found and verified. The important factors that would be looked into if we proceeded with the investigation were infrequent use and overall cleanliness of the ENEPIG line.

## Summary

The summary with regards to gold ball bonding process and pad metal lift discussed in this paper is as follows:

### Gold ball bonding

- The wire bonding evaluation in this study indicates that a ENEPIG plated surface finish can be compatible with the standard gold ball bonding process on bare boards. However, variation in wire bondability of populated boards within and between batches makes the application of the standard gold ball bonding process or the security bump

process difficult for volume production. Contamination on bonding pads during the SMT process seems to be the main factor for the variation in wire bondability of populated boards.

- The SSB process enables the gold ball bonding process on ENEPIG plated PCBs for volume production applications.

#### **Pad metal lift**

- PMLs were observed during the wire bonding process and/or wire pull test from multiple ENEPIG PCB samples.
- An overactive Ni bath resulting in compromised Ni deposit is a potential factor in PML on wire bonding pads.
- PMLs were observed with and without the evidence of hyper corrosion of Ni. PMLs due to hyper corrosion of Ni might be related to Au and Pd thickness, and/or Ni MTOs with multiple other contributing factors.
- Inclusions and hyper corrosion in the Ni layer in the wire bonding area that are at the smaller scale (approx. 5 um) could result in reliable re-wire bonding in the same pad.
- A tape test as per IPC-TM-650 is not an effective method to screen for PML on wire bonding boards.

#### **Acknowledgments**

The authors would like to acknowledge the following parties for their co-operation and technical support during PML problem solving activities: AT&S (Leoben, Austria), FTG (Toronto, Canada), TTM (Toronto, Canada). The authors would also like to acknowledge Gerard O'Brien from ST&S, for his ongoing support in resolution of PML and for bringing up this issue to the IPC 4-14 Plating Processes Subcommittee.

#### **References**

- [1] C. Fu, L. Hung, D. Jiang, C. Chang, Y. Wang, C. Haiso, "Evaluation of New Substrate Surface Finish: Electroless Nickel/Electroless Palladium/Immersion Gold (ENEPIG)", Electronic Components and Technology Conference, 1931-1935, 2008
- [2] N. Sitte, "Palladium as Diffusion Barrier – a Way to Multifunctional Printed Circuit Board Finish", Journal of the HKPCA, Issue No. 32, 18-25, Q2, 2009
- [3] Y. Oda, M. Kiso, S. Kurosaka, A. Okada, K. Kitajima, S. Hashimoto, "Study of Suitable Palladium and Gold Thickness in ENEPIG Deposits for Lead Free Soldering and Gold Wire Bonding", C. Uyemura and Corporation Ltd., Central Research Laboratory, Osaka, Japan and George Milard, Don Gudczauskas UIC Technical Center, Southinton, Connecticut, USA
- [4] K. Zeng, R. Stierman, D. Abbott, and M. Murtuza, "The Root Cause of Black Pad Failure of Solder Joints with Electroless Ni/Immersion Gold Plating", JOM, 75-79, June, 2006
- [5] K. Johal and S. Lamprecht, "Study of The Mechanism Responsible for "Black Pad" Defect on PWB's using Electroless Nickel / Immersion Gold as Final Finish", Atotech USA Inc. and Atotech Deutschland GmbH
- [6] ROHM and HAAS Electronic Materials Circuit Board Technologies "Why Electroless Nickel Electroless Palladium Immersion Gold (ENEPIG)?", Technical Communications, Sep 2008
- [7] P. Kondos, "ENEPIG: The "Universal" Finish?", Universal Instruments, AREA Consortium Meeting, October 2009
- [8] M. Oezkoek, G. Ramos, D. Metzger, H. Roberts, "The Benefits of ENEPIG with Pure Pd for Gold Wire Bonding", Atotech Deutschland GmbH, Berlin, Germany, and Atotech USA Inc., Rock Hill, SC

# Challenges on ENEPIG Finished PCBs: Gold Ball Bonding and Pad Metal Lift

**Young K. Song, Ph. D. and Vanja Bukva**

**Teledyne DALSA Inc., Waterloo, ON, Canada**



## Selection of PCB Surface Finishes

- Applications: Image sensor assembly
- Surface finish requirements:
  - SMT with reliable solder joints
  - Thermosonic gold ball bonding
- Electroless Nickel/Electroless Palladium/ Immersion Gold (ENEPIG) selected

**Part 1: Gold Ball Bonding**

Part 2: Pad Metal Lift

# Gold Ball Bonding

## PCB Samples Used

Table 1-SMT Process Used and Plating Specifications

Bare board sample	Flux type	Bonding Process	Plating thickness specifications (um)		
			Ni (P)	Pd (P)	Au
A	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
B	OA	gold ball bonding	3.0-8.0	0.3-1.0	0.05-0.18
C	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
D	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
E	No clean	aluminum wedge bonding	3.0-6.0	0.05-0.30	> 0.03

- PCB samples used for wire bonding evaluations: A, B, and C

# Gold Ball Bonding

PCB used for wire bonding evaluation

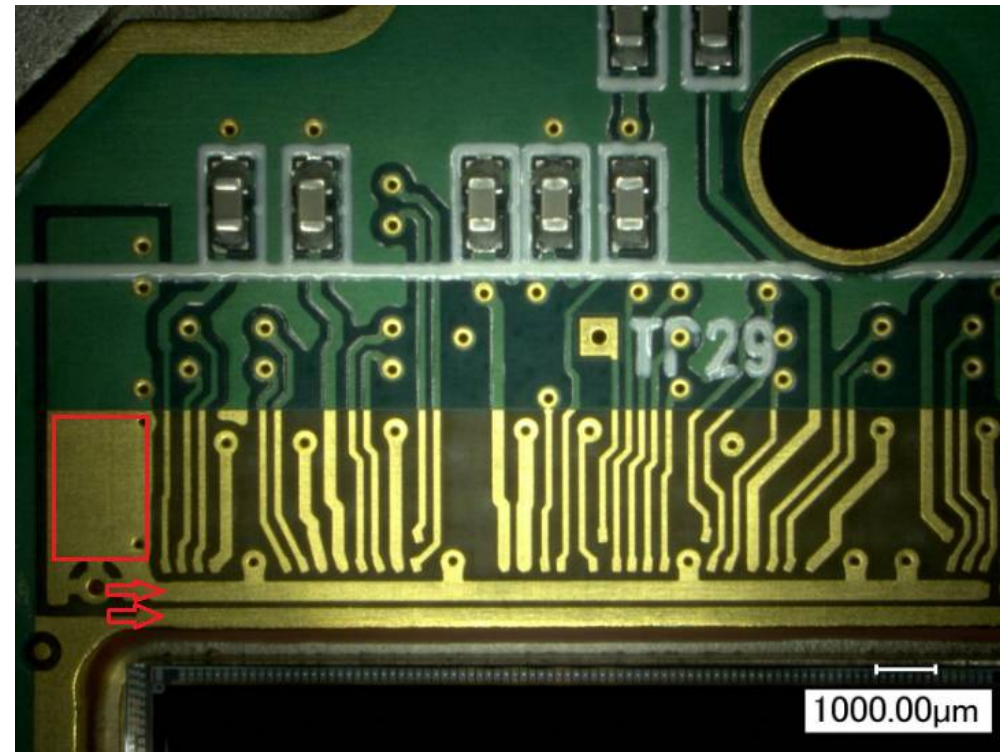


Figure 1 – Partial View of Sample PCB

# Gold Ball Bonding

## Standard Bonding Process

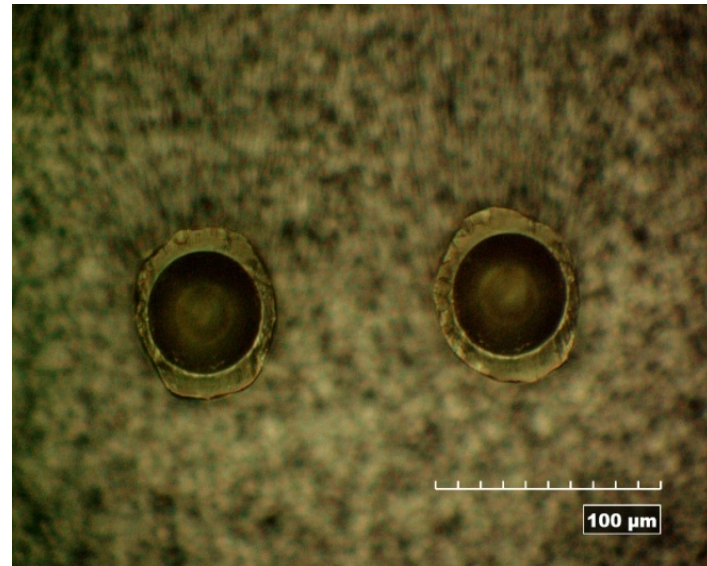


Figure 2-Ball Bonds (1<sup>st</sup> Bonds)


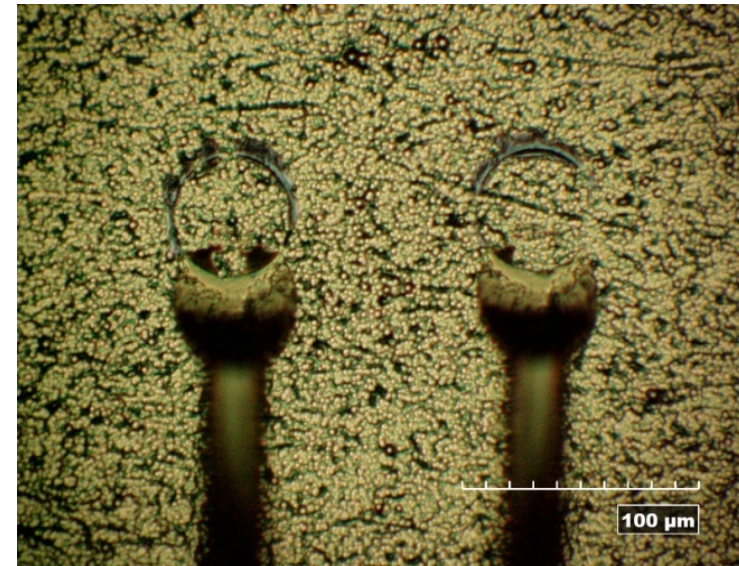


Figure 3-Stitch Bonds (2<sup>nd</sup> Bonds)

- Bondability of ball bonds (1<sup>st</sup> bonds) better than that of stitch bonds (2<sup>nd</sup> bonds).

# Gold Ball Bonding

## Standard Bonding Process

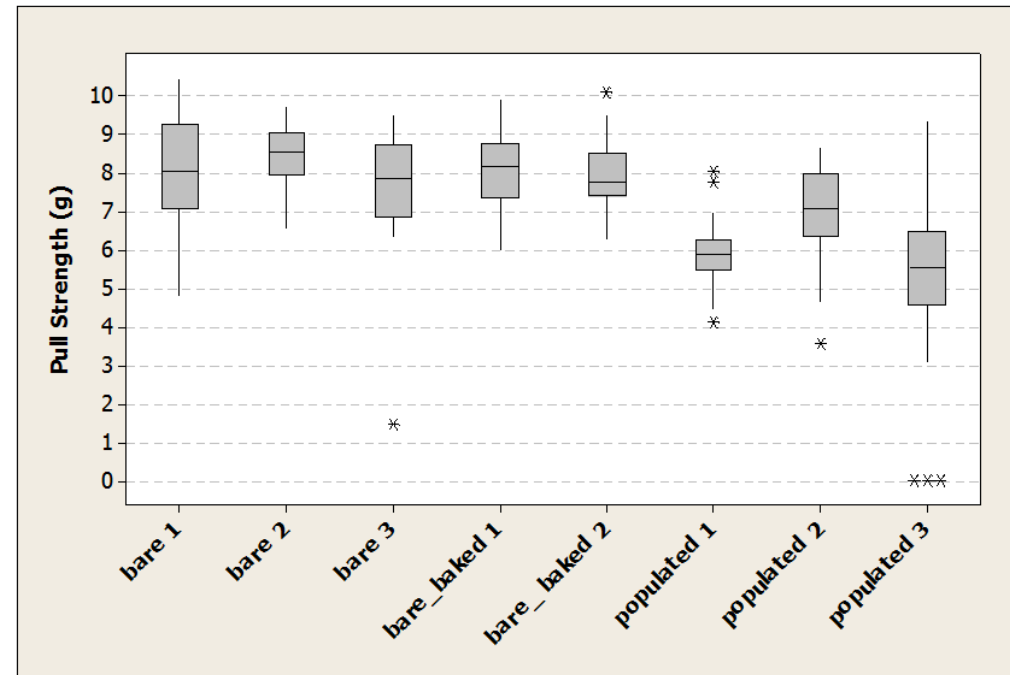

**Figure 4 – Wire Pull Strength Comparison Between Bare and Populated Boards from Sample A**

- Wire pull strength on populated boards lower than that on bare boards.
- Wire pull strength on bare boards baked at 245C/5min. same as that on bare boards.
- Outliers in bare board 3 and populated board 3.

# Gold Ball Bonding

## Standard Bonding Process

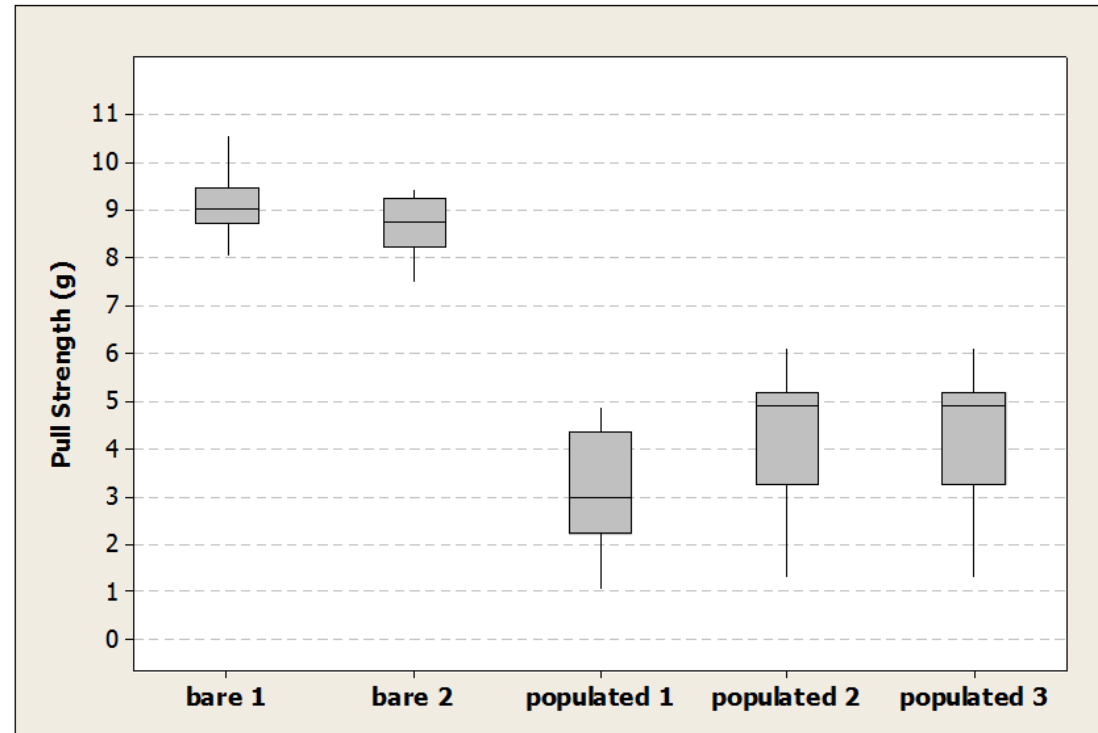


Figure 5 – Wire Pull Strength Comparison between bare and populated boards from Sample B

# Gold Ball Bonding

## Variation in Bonding Tool Marks

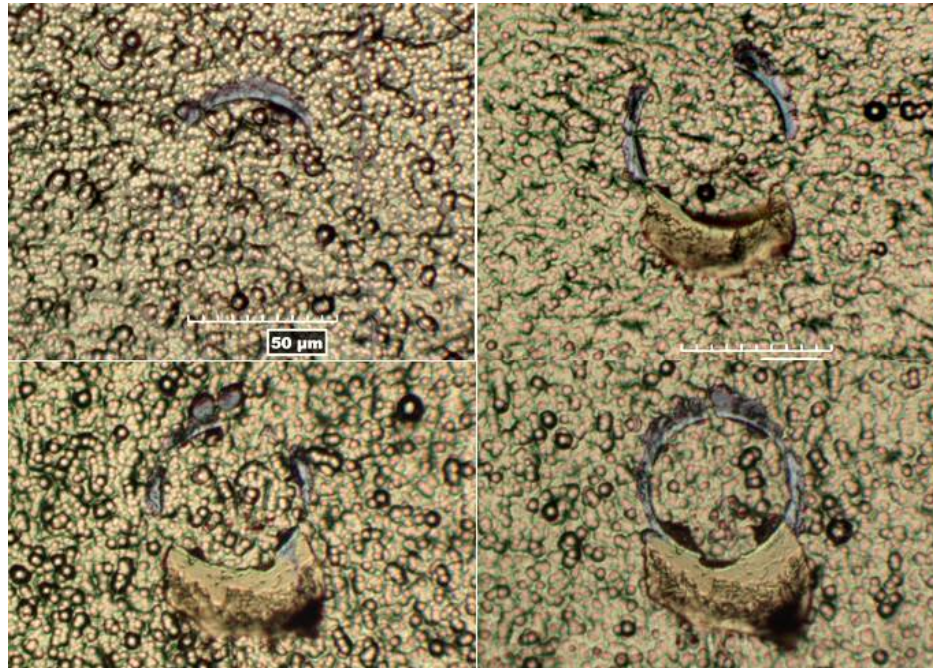


Figure 6 – Variation in Bonding Tool Marks


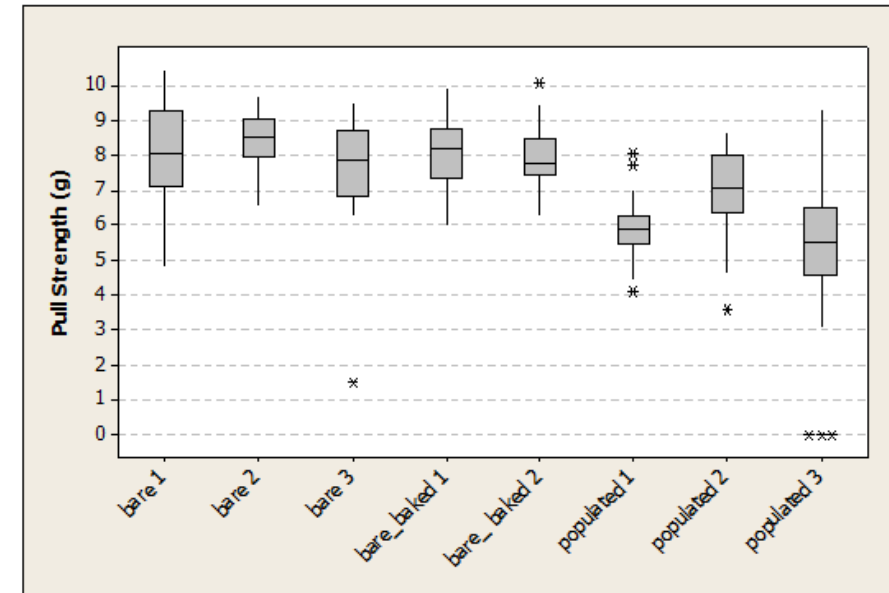


Figure 4 – Standard bonding from Sample A



# Gold Ball Bonding

## Standard Bonding Process






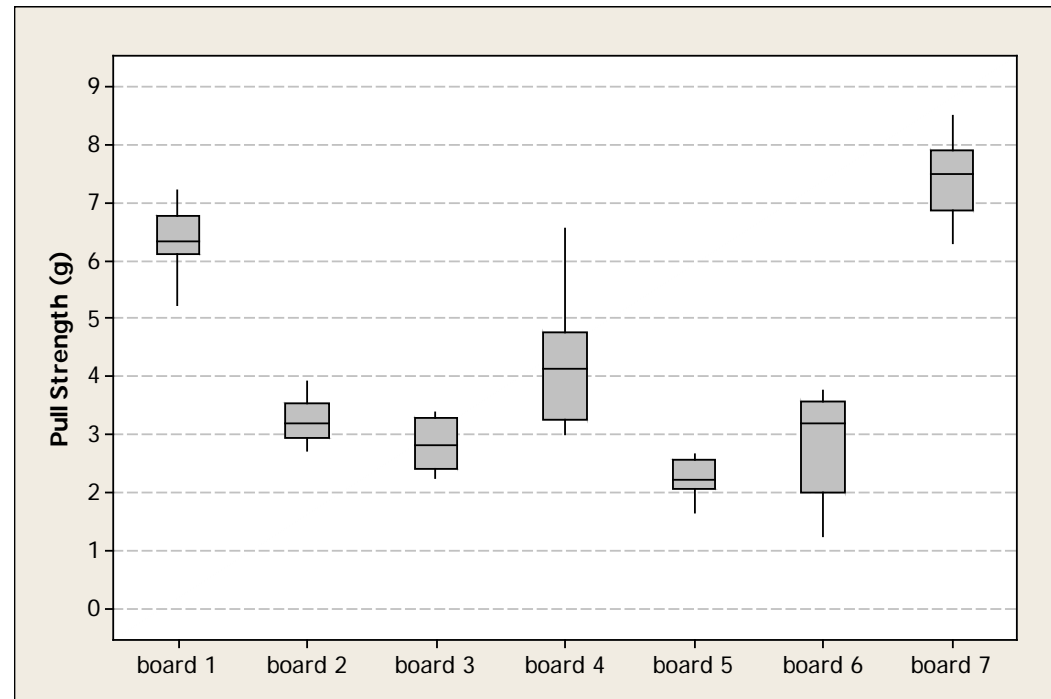


**Figure 7 – Wire Pull strength from mixed batches of populated boards from Sample C**

- Large variation in pull strength from populated boards.

# Gold Ball Bonding


Gold Ball Bonding Processes: Standard, Security Bump, and SSB (Stand-Off-Stitch Bond)

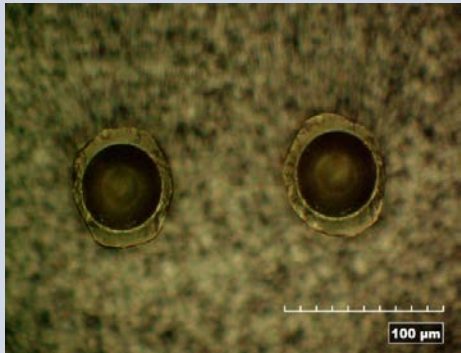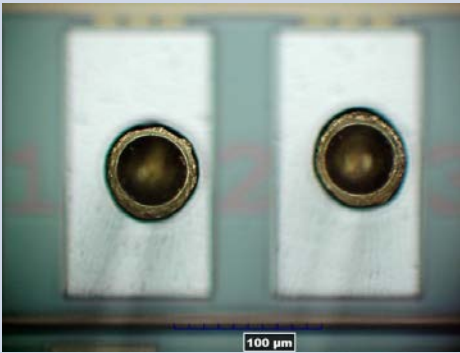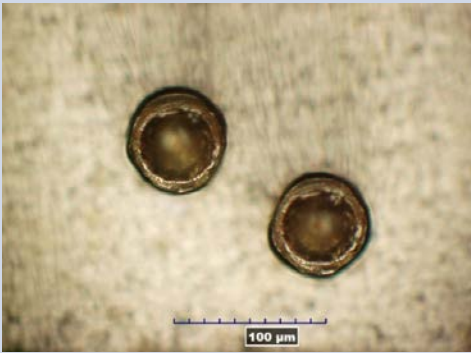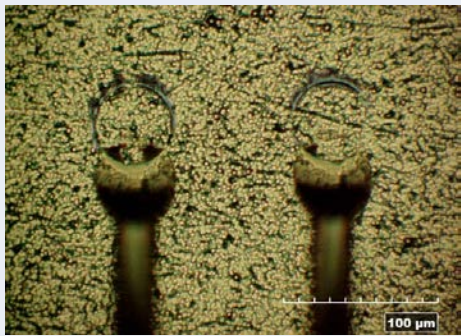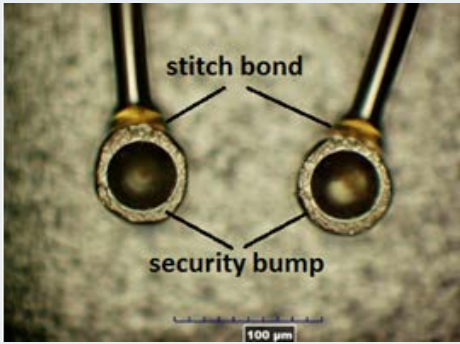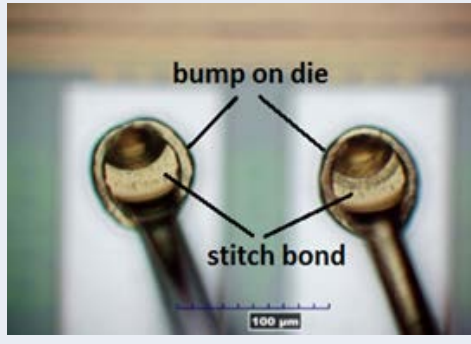	Standard Bonding	Security Bump	SSB
Ball Bonds	 <p>Figure 2</p>	 <p>Figure 8</p>	 <p>Figure 10</p>
Stitch Bonds	 <p>Figure 3</p>	 <p>Figure 9</p>	 <p>Figure 11</p>

- Bonding order for standard bonding process: ball bond → stitch bond
- Bonding order for security bump process: ball bond → stitch bond → security bump
- Bonding order for SSB process: bump on die → ball bond → stitch bond on bump

# Gold Ball Bonding

## SSB process

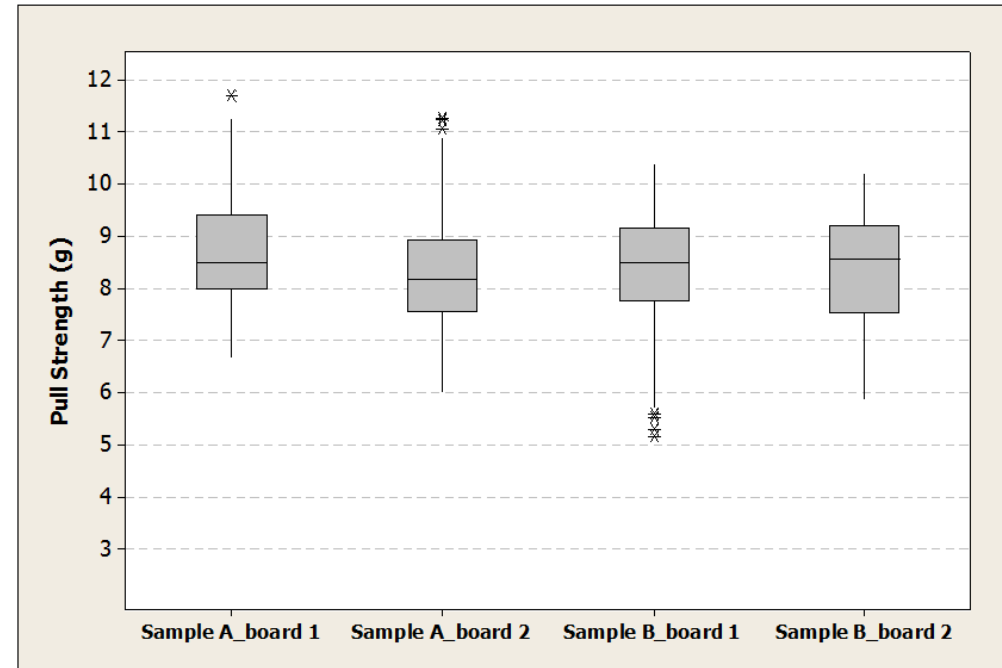

**Figure 12 – Wire Pull Strength from Populated Boards with SSB Process (Sample A and Sample B)**

- Variation in pull strength due to variation in loop height and wire bond length rather than variation in bondability on PCB.
- Stable wire bonding process without machine stoppages.
- No bond lift failure on PCB during wire pull tests.
- Most wire bonds showed neck break (wire break) failure mode during pull test.

# Gold Ball Bonding

## Summary

### Standard bonding process

- Compatible on bare boards.
- Difficult due to variation in wire bondability on populated boards.
- Contamination remaining on wire bonding pads from SMT process is likely to be the main factor for the variation.

### SSB process

- Successfully introduced for production with good process stability and wire bond integrity .

- Part 1: Gold Ball Bonding on ENEPIG
- Part 2: Pad Metal Lift**

# Pad Metal Lift

**Table 1- SMT Process Used and Plating Specifications**

Bare board sample	Flux type	Bonding Process	Plating thickness specifications (um)		
			Ni (P)	Pd (P)	Au
A	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
B	OA	gold ball bonding	3.0-8.0	0.3-1.0	0.05-0.18
C	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
D	OA	gold ball bonding	3.0-5.08	0.1-0.2	0.05-0.15
E	No clean	aluminum wedge bonding	3.0-6.0	0.05-0.30	> 0.03

- Investigation and analysis done on bare board samples A, D and E.

# Pad Metal Lift


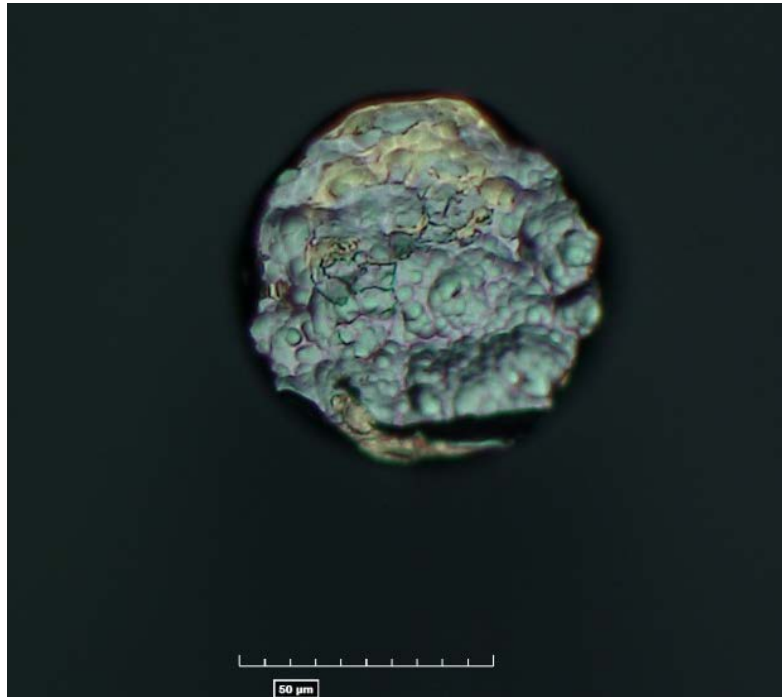



Figure 13 - Bottom of a Lifted Bond

- The palladium (Pd) layer was completely separated from the nickel (Ni) either during wire bonding or during the sample destructive wire pull tests.
- PMLs have been observed from both bare and populated boards, therefore, they do not seem to be related to the SMT process.

# Pad Metal Lift

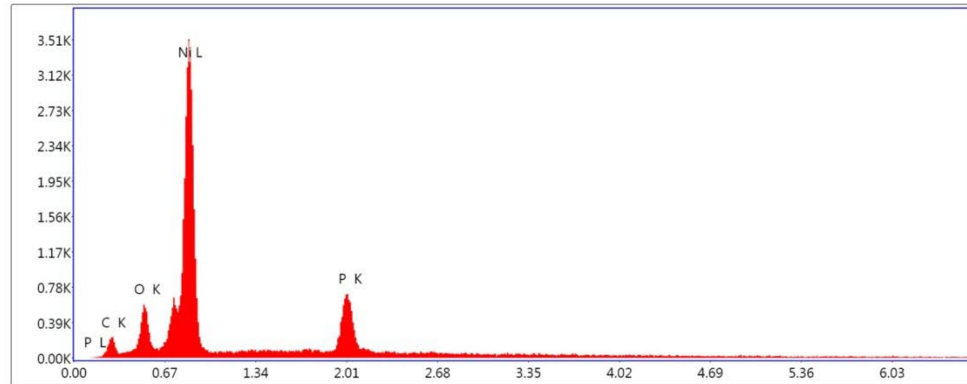

**Figure 14 - EDS Analysis Spectrum Obtained from The Area on Bonding Pad with Lifted Bond**

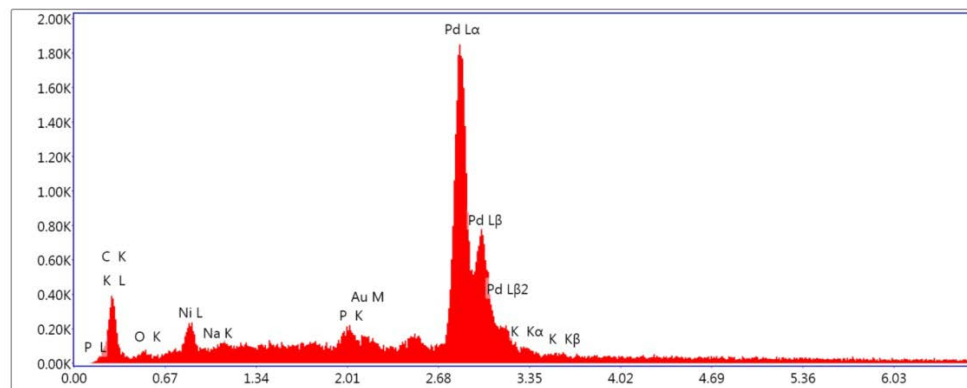

**Figure 15 - EDS Analysis Spectrum Obtained from The Bottom of Lifted Bond**

- Separation of the Pd layer from the Ni layer was confirmed by EDS analyses conducted on the area on the bonding pad with the lifted bond and the bottom of lifted bonds as shown in Figure 14 and Figure 15, respectively.
- Ni was the major element in the area on the bonding pad with a lifted bond in Figure 14.
- Pd was the major element detected at the bottom of the lifted bond in Figure 15.




# Pad Metal Lift

## Sample A



**Figure 16 - Five Black Circles Represent PML Including Attempts to Repair**

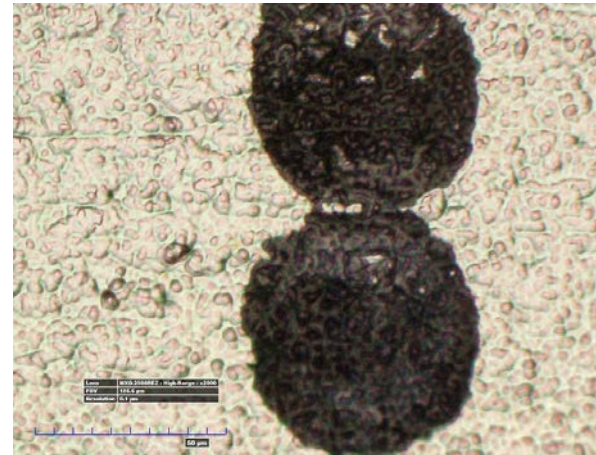

**Figure 17 – Zoom in on PML Area**

- A supplier noticed a process issue during the production of this batch.
- The root cause proposed by the supplier was an overactive Ni bath.
- Caused by temperature or excessive copper loading, or a combination of both.
- It was determined that the copper loading had been excessive over the course of several consecutive loads.
- ENEPIG plating was found on the solder mask and some boards failed tape test for poor Pd adhesion to Ni.
- The tape testing, which was performed per IPC-TM-650, was not effective in completely screening out the PCBs affected and wire bonding failures were observed.

# Pad Metal Lift

## Sample D – First Example

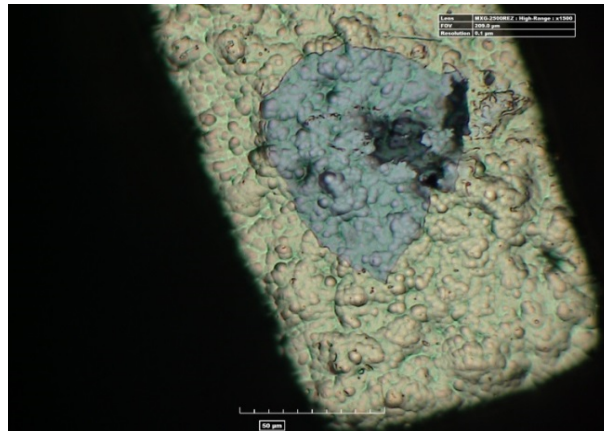


Figure 18 - PML from Sample D

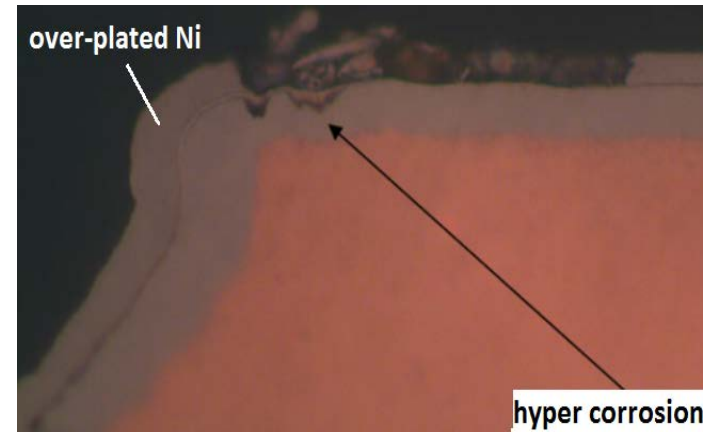


Figure 19 – Image of Edge Hyper Corrosion at Lens 1000x (ignore top, over-plated layer for sample preparation)

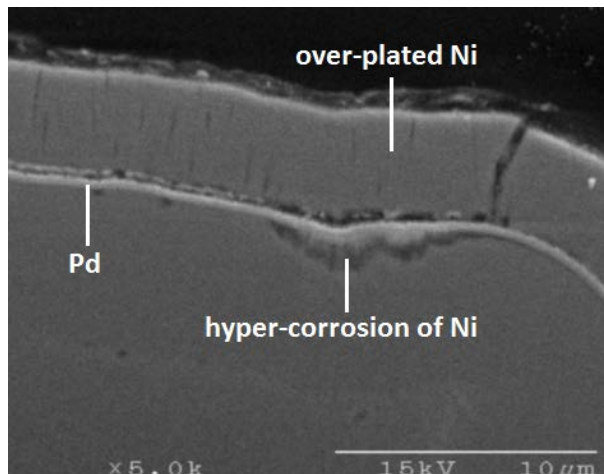


Figure 20 – SEM Image of the Edge of the Pad Showing Hyper Corrosion of the Ni Beneath the Pd

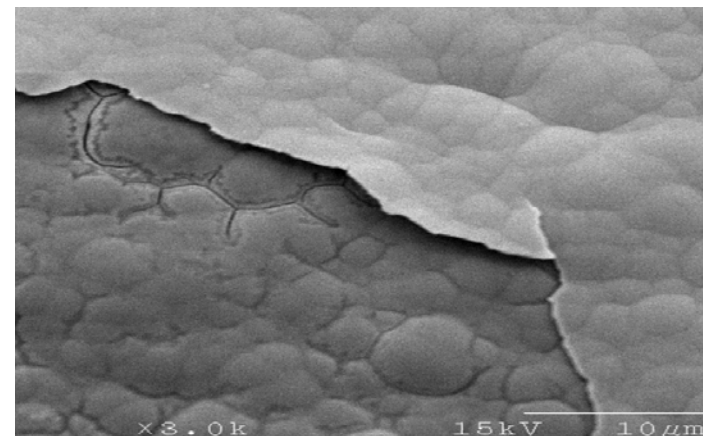


Figure 21 – SEM Image of the Same Failed Site Showing Lifting Pd and Hyper Corrosion of the Ni

# Pad Metal Lift

## Sample D – First Example

- XRF measurements of the failed board demonstrated the thinnest Pd deposit combined with the thickest Au deposit, both within tolerance of the IPC-4556 specification for plating thickness.
- The combination of thin Pd and thick Au deposit appeared to compromise Pd bond strength possibly from the undercutting of the Ni/Pd interface due to localized heavy hyper corrosion.

**Table 2 – Plating Thickness for Reduced Hyper Corrosion**

Thickness	Original specification	Modified specification to minimize hyper-corrosion
Au	0.05 – 0.15 um (2 – 6 uin)	0.03 – 0.06 um (1.2 – 2.4 uin)
Pd	0.10 – 0.20 um (4 – 8 uin)	0.15 – 0.30 um (6 – 12 uin)
Ni	3 - 5um (118 – 200 uin)	3 – 6 um (118 – 236 uin)*

\*Increased Ni thickness to be consistent with IPC-4556, not relevant to hyper corrosion investigation.

- Two trials were performed with the modified plating thickness specification, with two different suppliers and results were encouraging. No PML was observed during wire bonding and wire pull tests.
- The cross-section was performed on trial boards from both suppliers and hyper corrosion was not observed.

# Pad Metal Lift

Sample D – Second Example

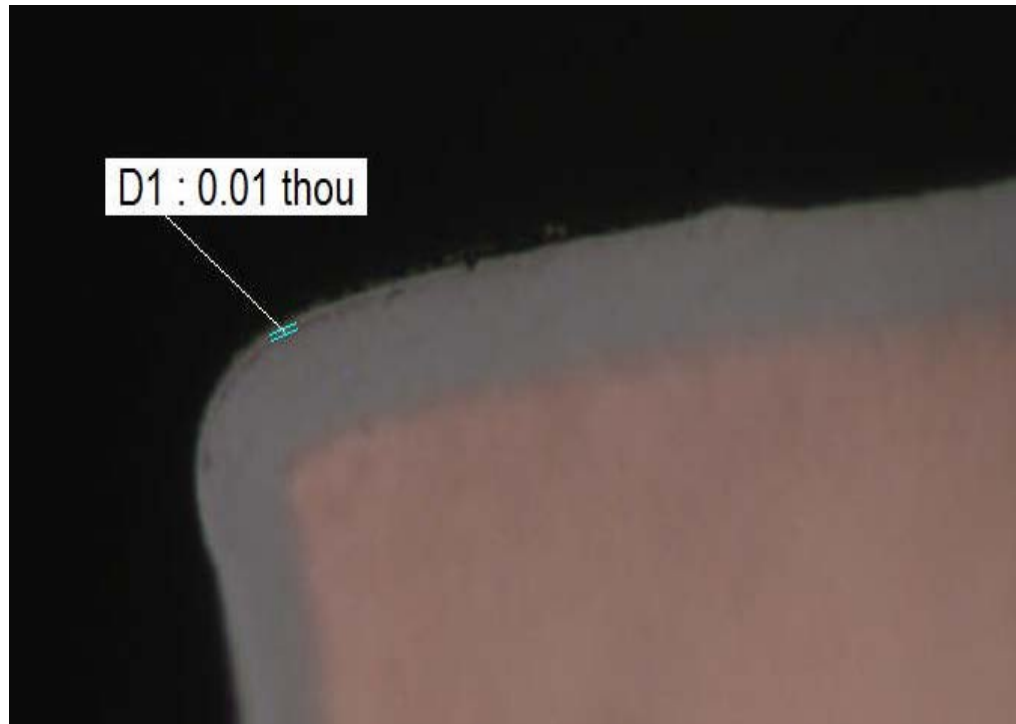


Figure 22 - Edge of the Pad Showing Demarcation Line at 1000x Lens.

- Cross-sectioned boards exhibited the separation between the Pd and Ni without hyper corrosion of Ni.

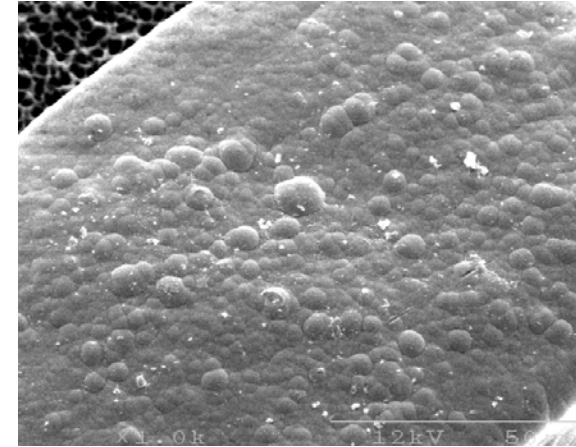


Figure 23 – SEM Image of Wire Bond Pad Showing Variation in the Grain size of Ni Deposit at 1000x -> Not responsible for PML

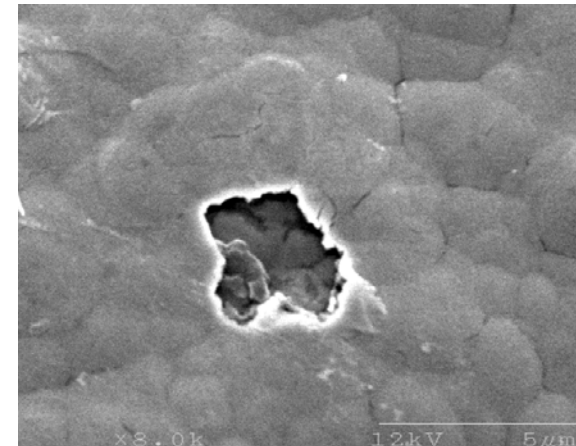


Figure 24 – SEM Image Showing Missing Pd at 8000X

# Pad Metal Lift

Sample D – Third Example

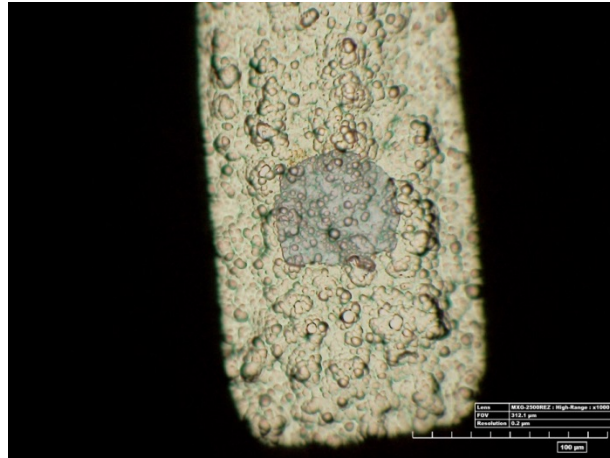


Figure 25 – Optical Microscope Image of PML

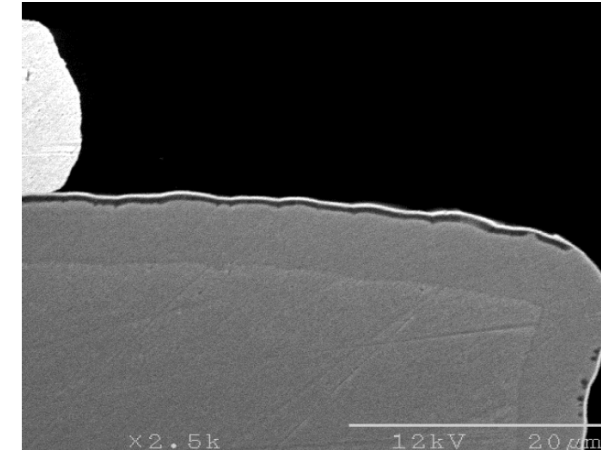


Figure 26 – SEM Image at 2500X Showing Extensive Hyper Corrosion

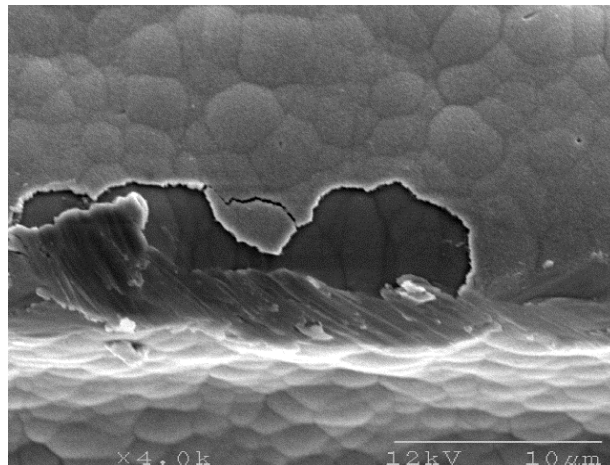


Figure 27 – SEM Image at 4000X Showing the Lifting Pd Layer

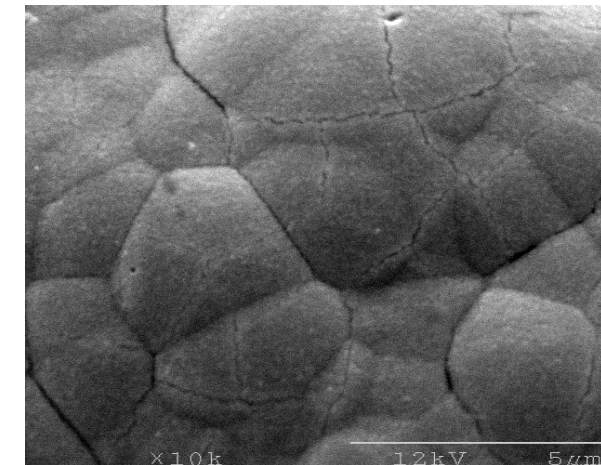


Figure 28 – SEM Image of the Pd Surface Showing the Trans-granular Cracking of the Pd

# Pad Metal Lift

## Sample D – Root Cause Analysis


Involved review of multiple variables at the PCB manufacturer as follows:

- Si content in the plant DI water was found to be 4 PPM. The Si levels dropped to 0.004 PPM after DI columns were added to strip Si from the water supply.
- The rinse time after Ni plating (before Pd plating) was reduced from 60s to 30s to minimize possibility of Ni oxidation.
- The practice was improved by eliminating panels being placed on hold prior to final Au finish in order to reduce the amount of oxidation on panels.
- A custom heating coil and a cooling coil were added in Pd tank.
- Improvement of Ni bath Metal Turn Overs (MTOs) to 1 MTO.


# Pad Metal Lift

## Sample E – First Example

- PCBs wire bonded using Al wedge bonding.
- Cross-section: very localized separation between Ni and Pd.
- No hyper corrosion present in Ni.
- Some disturbance caused the change in plating direction.

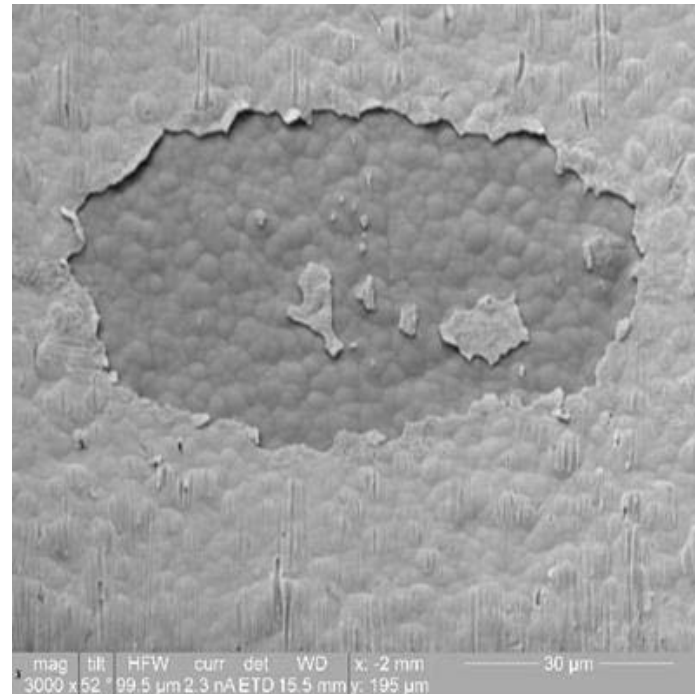


**Figure 29 - SEM Image of the Lifted bond at 3000x**

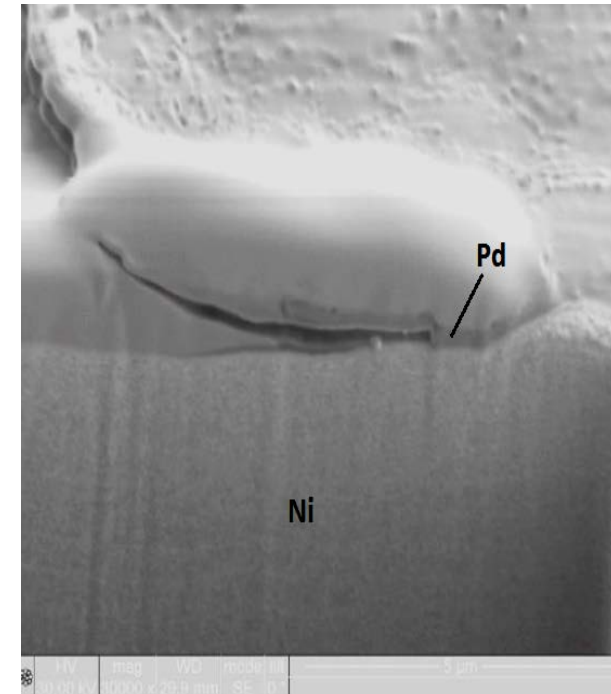

**Figure 30 - FIB Image of the lifting Pd from Ni at 30,000X**

# Pad Metal Lift

## Sample E – Second Example and Overall Root Cause

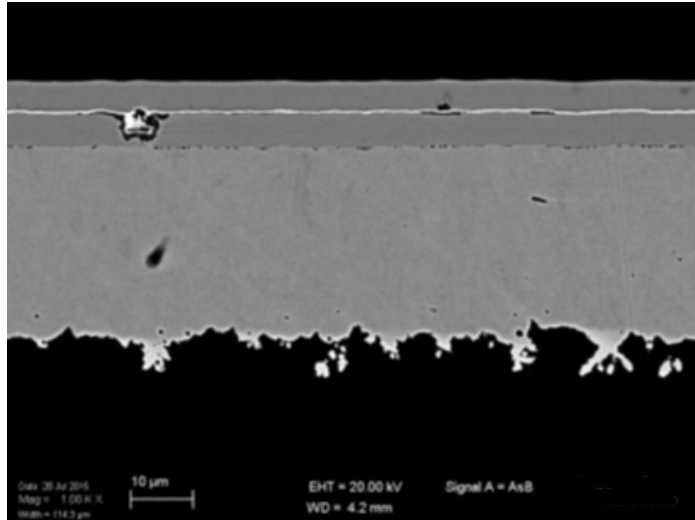

**Figure 31 - Inclusion in Ni layer and Ni Hyper Corrosion**

- Inclusion in the Ni layer and hyper corrosion.
- Size about 5 µm wide; much smaller than in the sample D PCBs (about 50 µm).

- Even though a tape test as per IPC-TM-650 had been implemented on each PCB at the supplier, as well as at receiving, PML still occurred during wire bonding.
- Attempts to repair wire bonds in the adjacent area where PML occurred were successful without PML occurring during the wire bonding and pull test.
- Boards were sent for temperature cycling testing (TCT) and there were no wire bond failures observed.
- The root cause investigation of PML was halted before the root cause had been found and verified.
- The important factors that would be looked into if we proceeded with the investigation were infrequent use and overall cleanliness of the ENEPIG line.



# Pad Metal Lift

## Summary

- PMLs were observed during the wire bonding process and/or wire pull test from multiple ENEPIG PCB samples.
- An overactive Ni bath resulting in compromised Ni deposit is a potential factor in PML on wire bonding pads.
- PMLs were observed with and without the evidence of hyper corrosion of Ni. PMLs due to hyper corrosion of Ni might be related to Au and Pd thickness, and/or Ni MTOs with multiple other contributing factors.
- Inclusions and hyper corrosion in the Ni layer in the wire bonding area that are at the smaller scale (approx. 5 um) could result in reliable re-wire bonding in the same pad.
- A tape test as per IPC-TM-650 is not an effective method to screen for PML on wire bonding boards.

# Acknowledgments

- The authors would like to acknowledge the following parties for their co-operation and technical support during PML problem solving activities: AT&S (Leoben, Austria), FTG (Toronto, Canada), TTM (Toronto, Canada).
- The authors would also like to acknowledge Gerard O'Brien from ST&S, for his ongoing support in resolution of PML and for bringing up this issue to the IPC 4-14 Plating Processes Subcommittee.